

LAND CORNER RECORDATION CERTIFICATE
FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF -: LOCATED IN -: CORNER CODE NUMBER
1. PUBLIC LAND SURVEY T. 3 N. R. 2 M-4
2. PROPERTY CONTROLLING IN SECTION T. N. E. S. R. W.
3. MISCELLANEOUS PROPERTY IN SECTION T. N. E. S. R. W.
4. LOT NO. RECORDED PLAT
5. PRIVATE CLAIMS

25-18-108


REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Ronnie M. Lester, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on Sept. 11, 1978, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on, 19, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

- A. Description of original monument and accessories and/or subsequent restoration: M-4 Post set in original government survey by Joseph Wampler dated Dec., 1825. Corner referred to in a survey by E.N. Fairchilds dated 1857 and in a re-survey by Louis D. Preston, County Surveyor, dated Sept. 27 & 29, 1879 in the Miscellaneous County Surveyor's Field Notes. Corner identified as a gas pipe in a survey attributed to John McCreary, County Surveyor, dated May, 1905 in the Miscellaneous County Surveyor's Records (Leroy-brown folder). Corner referred to in C & O Right of Way Map (Val. Sec. 2B, Drawer A1 #29).
B. Description of corner evidence found and/or method applied in restoring or re-establishing corner: M-4 Excavated a hole 10' x 10' to an average depth of 2.2', mostly west of the centerline of Wallace Road on extended fence line to the west. Found a 1 1/2" x 4.5' gas pipe, with 0.75' of the top being broken and bent, 0.9' below surface, with the remaining 3.7' of the pipe in an upright position surrounded by four small stones, 4.7' below road surface in brown sand, + 6.0' west of the centerline of Wallace Road and on extended fence line to the west. Accepted gas pipe as corner referred to in a survey by John McCreary noted above. Excavation conducted by Ingham County Survey and Remonumentation Project crew.
C. Description of monument for corner and accessories established to perpetuate locating the position of the corner: M-4 E 1/2 Corner, Section 12, T3N-R2E Set 4" x 36" concrete monument with 1/2" x 38" rerod and cap #18998, and concrete sleeve in location of gas pipe described above: Nail & tag, #18998, east side 20" Wild Cherry, SW, 23.67' Nail & tag, #18998, northwest side 40" Double Wild Cherry, NE, 60.54' Nail & tag, #18998, northeast side 24" Wild Cherry, SE, 50.83' Nail & tag, #18998, southeast side 10" Wild Cherry, SSW, 43.38'

SIGNED BY Ronnie M. Lester DATE Dec 12, 1978

SURVEYOR'S MICHIGAN REGISTRATION NO. 18998

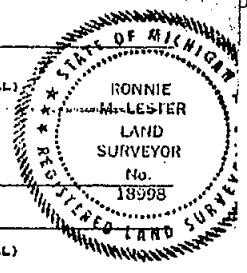

SIGNED BY Gary D. Lester DATE 12-15-78



CHIEF OF SURVEY PARTY MICHIGAN REGISTERED LAND SURVEYOR Director, Ingham County Survey and Remonumentation Project SURVEYOR'S MICHIGAN REGISTRATION NO. 17624

INGHAM COUNTY-LEROY TWP.  
**LAND CORNER RECORDATION CERTIFICATE**  
 FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF --:	LOCATED IN --:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>3</u> N. <u>3</u> , R. <u>2</u> E. <u>W</u>	M-5
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. _____ S. _____ R. _____ E. _____ W. _____	
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ S. _____ R. _____ E. _____ W. _____	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

L.51 P. 227


REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Ronnie M. Lester, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on November 21, 1978, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

- A. Description of original monument and accessories and/or subsequent restoration:  
 M-5  
 Post set in original government survey by J. Wampler, December 1-8, 1825.  
 Corner referred to in a re-survey of the County Line (now Wallace Road) by E.N. Fairbanks, County Surveyor, 1857 and L.D.Preston, County Surveyor, September 27-29, 1879.  
 Corner identified as iron and crockery in Miscellaneous County Surveyor's Notes (Leroy-tan folder) in a survey by J. McCreary, County Surveyor, May 25-27, 1905.  
 Corner identified as 3/4" iron in Consumers Power records and the MDSHT Government Monument Witness Form 280, 1960.
- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:  
 M-5  
 Excavated a 10' x 10' hole to an average depth of 0.8' on centerline of Wallace Road and on fence line east. Found 1" x 1.2" gas pipe surrounded by 30 (1" to 2") pieces of crockery with an iron piece 1" x 1/8" x 3' along side, 0.8' below surface + 3.0' east of centerline of Wallace Road, on fence line east. Found a 3/4" x 2.1" pipe on centerline of Wallace Road at a depth of 0.5' and on fence line east. Measured + 2650' north to M-4, and south 97.06' to apparent location of A-5, Handy Twp., T3N-R3E, Livingston Co., both in close accord to G.L.O. measurements. Accepted gas pipe and crockery for corner as called for by J. McCreary in survey noted above.  
 Excavation conducted by Ingham County Survey and Remonumentation Project crew.
- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
 M-5  
 NE Corner, Section 13, T3N-R2E  
 Set 4" x 36" concrete monument with 1/2" x 38" rerod and cap #18998, and concrete collar with cap in location of gas pipe and crockery described above:  
 SW Corner of house, #2484 at block foundation, SE, 67.76'  
 Nail & tag, #18998, west side 24" Elm, ESE, 37.31'  
 Nail & tag, #18998, north side wood corner post, East, 30.45'  
 Nail & tag, MDSHT, northeast side 30" Maple, SSW, 44.36'  
 Concrete monument at apparent location of A-5, Handy Twp., T3N-R3E, Livingston County, South, 97.05'

SIGNED BY Ronnie M. Lester DATE April 3, 1979

SURVEYOR'S MICHIGAN REGISTRATION NO. 18998

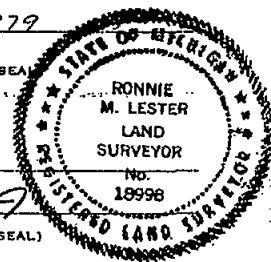

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

APPROVED AND SIGNED BY Gary J. Lester DATE 4-20-79  
 CHIEF OF SURVEY PARTY  
 MICHIGAN REGISTERED LAND SURVEYOR  
 Director, Ingham County Survey and Remonumentation Project  
 REGISTRATION NO. 17624



MAY PLACE SKETCH ON BACK OR ATTACHED SHEET

# LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. ... S. ... R. ...	
2. PROPERTY CONTROL L. 12 ING IN SECTION	T. ... S. ... R. ...	K-4: <span style="border: 1px solid black; border-radius: 50%; padding: 2px;">L-4 L-4</span>
3. MISCELLANEOUS PROPERTY IN SECTION	T. ... S. ... R. ...	
4. LOT NO. ... RECORDED PLAT		
5. PRIVATE CLAIMS		

LIBER 5 PG 174

FILED

JAN 31 10 36 AM '79

REGISTER OF DEEDS  
INGHAM COUNTY, MICH.

REGISTER OF DEEDS STAMP AND  
FILING NUMBER

I, Oscar Boss, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on April 26, 1973, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on 19 found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of Law:

A. Description of original monument and accessories and or subsequent restoration:

K-4: Unknown

L-4: Unknown

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

K-4: Set 1/2" Iron at SE cor. Lot 6 of "Fisher's Addition to Leroy", L.59 of Deeds, page 272, Ingham Co. Records.

L-4: Set 1/2" Iron on W/S steel fence post at 4-way fence intersection (N-S-E-W).

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-4: W. 1/4 Cor. Sec. 12 T3N-R2E  
NE 11.19' steel for. post (fence N-E)  
ENE 14.12' N. W/S 12" Poplar  
East 17.53' N. N/S 8" Poplar  
South 15.42' power pole

L-4: Center Sec. 12, T3N-R2E  
NNW 44.70' N. E/S 36" Ash  
ENE 28.33' N. W/S tw 20" Ash  
SSE 18.15' N. E/S 6" Ash

SIGNED BY Oscar Boss

DATE 1-22-79

SURVEYOR'S MICHIGAN REGISTRATION NO. 13574

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_

DATE \_\_\_\_\_

APPROVED AND SIGNED BY \_\_\_\_\_

DATE \_\_\_\_\_

MICHIGAN REGISTERED LAND SURVEYOR



SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

**1561 T3N-R2E L-4 ATT. 0**

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN 28, 1971  
REVISED MAY 14, 1975

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET

SOURCE: CORNER RECORDATION CERTIFICATE

TRANSCRIBED from ORIGINAL on file at REGISTER OF DEEDS

LAND CORNER RECORDATION CERTIFICATE  
FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

LIBER 38 89

FOR CORNER OF...	LOCATED IN...	CORNER CODE NUMBER	FILED
1. PUBLIC LAND SURVEY	33	3, 4, 5, 6, 10, 11, 12, 13, 14, 15, 16	
2. PROPERTY CONTROL			
3. MISCELLANEOUS PROPERTY IN SECTION			
4. LOT NO.	RECORDED PLAT		
5. PRIVATE CLAIMS			

I, DEBBIE JARON, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on 12/23/74, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on 12/23/74, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of Law.

FILED

A. Description of original monument and accessories and/or subsequent restoration:

- K-5 Unknown
- K-6 Unknown
- L-5 Unknown
- L-6 Unknown

APR 25 9 20 AM '74  
REGISTER OF DEEDS  
Paul M. O'Neil  
INGHAM COUNTY, MICH.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corners:

- K-5 1" pipe sd.
- K-6 3/4" pipe sd.
- L-5 set 1/2" iron on fence L-W on fence line from center of sep. extended Northwly
- L-6 set 1/2" iron on fence line N-U-L-W

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- |   |   |
|---|---|
| <p>K-5 NW Corner</p> <p>South 21.93 Nail E/W 2 1/2" Maple</p> <p>8.47" W. 30.23 Nail N/W 1 1/2" Maple</p> <p>U.55" E. 46.52 Nail W/W 10" Poplar</p> | <p>L-5 N 1/4 corner</p> <p>8.65" W. 32.98 N/G 2 1/2" Oak</p> <p>8.65" W. 64.33 N/W 2 1/2" Oak</p> <p>8.60" E. 56.48 W/G 8" Elm</p>      |
| <p>K-6 W 1/4 corner</p> <p>8.5d" W. 30.88 Nail W/W 12" Ash</p> <p>U.73" W. 91.08 Nail N/W 12" Ash</p> <p>North 16.76 Nail 1/2" Tele Pole</p>        | <p>L-6 Center Box</p> <p>2.45" 31 1/2. 12.19 10" Ash</p> <p>N.20" W. 27.08 8" Ash</p> <p>8.05" W. 2 x 8 angle iron corner post 8.15</p> |

SIGNED BY Debbie Jaron DATE 4-10-74

SURVEYOR'S MICHIGAN REGISTRATION NO. 32275

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, INC. 1971  
REPRODUCED BY MICHIGAN SOCIETY OF REGISTERED LAND SURVEYORS

688