

JAN 15 10 22 AM '93

REGISTER OF DEEDS
Frank O. Anderson
INGHAM COUNTY, MICH.

Register of Deeds Stamp & File Number

Land Survey T 3N R 1E C-4

County Controlling S T R R

ation S T R R

ilaneous S T R R

erty in Sec. S T R R

	A	B	C	D	E	F	G	H	I	J	K	L	M
2													
3													
4													
5													
6													
7													
8													
9													
10													
11													
12													
13													

Y A. Bryan, in a field survey on December 3, 1992, certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned and 2 above were in conformance with regulations and rules therefore as required in the annual of survey instructions of the United States Department of the Interior, Bureau of Land and/or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 are in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Law, established, re-established, monumented, re-monumented, recovered, found as below:

Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

Description of original monument and accessories and/or subsequent restoration:


Original monument and accessories destroyed. Corner was established June 23, 1865 by W.H. Rayner County Surveyor.

Description of corner evidence found and/or method applied in restoring or reestablishing corner:

1 Set 1/2" bar & cap #25832 in hole of old anchor post on East-West fence line. Measurements East, West and South are in close accord with County Surveyor and G.L.O. records.

Description of monument for corner and accessories established to perpetuate locating the position of the corner:

1 West 1/4 corner Section 8 (1/2" bar & cap #25832)
Set nail & tag #25832 North side 16" Oak, S45°E, 12.75'
Set nail & tag #25832 Northwest side 10" Oak, N50°E, 8.12'
Set nail & tag #25832 South side 8" Ash, N88°W, 8.30'

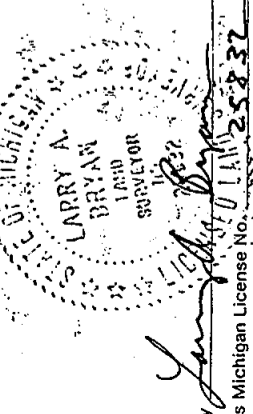

BY Larry A. Bryan Date 1-6-93

LAND CORNER RECORDATION CERTIFICATE
FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	18 T. 3N. R. 1E	A-5, A-6, A-7
2. PROPERTY CONTROLLING IN SECTION	T. N. R. E. S. W.	
3. MISCELLANEOUS PROPERTY IN SECTION	T. N. R. E. S. W.	
4. LOT NO. _____	RECORDED PLAT _____	
5. PRIVATE CLAIMS _____		

LIBER 4 PG 99

FILED

SEP 23 11 26 AM '77

REGISTER OF DEEDS
Paul Johnson
 INGHAM COUNTY, MICH.

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, George M. Young, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on June 9, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on June 9, 1977, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

- A. Description of original monument and accessories and/or subsequent restoration:
- A-5 Original monument & accessories obliterated
 - A-6 Original monument & accessories obliterated
 - A-7 Original monument & accessories obliterated

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- A-5 Set corner on section line 234 chains north of NE corner of Section 13, T3N, R1E
- A-6 Set corner on section line at a prorated distance measured between SW corner of Section 19 & NW corner of Section 18, T3N, R1E
- A-7 Set corner on section line at a prorated distance measured between SW corner Section 19 & NW corner Section 18, T3N, R1E

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- | | |
|--|---|
| A-5 #16 Nail & Cap in 40" Maple N10°E 279.41' | A-7 #16 Nail & Cap in 18" Ash N20°E 148.65' |
| #16 Nail & Cap in Anchor Post S50°E 38.02' | #16 Nail & Cap in 18" Ash N40°E 52.12' |
| South edge of South direction sign post N80°W 26.08' | #16 Nail & Cap in 15" Ash N80°E 107.25' |
| Set 1/2" x 24" Re-rod with cap | Set 1/2"x24" Re-rod with Cap |
| A-6 #16 Nail & Cap in 15" Oak N30°E 87.15' | |
| #16 Nail & Cap in P.P. S85°E 144.13 | |
| #16 Nail & Cap in 15" Oak S20°E 153.96' | |

SIGNED BY George M. Young
 SURVEYOR'S MICHIGAN REGISTRATION NO. 17640
 FOR STATE AND UNITED STATES AGENCIES:



August 10, 1977

(REAL)

FOR CORNERS OF--
 1. PUBLIC LAND SURVEY
 2. PROPERTY CONTROLLING IN SECTION
 3. MISCELLANEOUS PROPERTY IN SECTION
 4. LOT NO. _____ RECORDED PLAT _____
 5. PRIVATE CLAIMS _____

I, George M. Young, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on June 9, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law.

A. Description of original monument and accessories and/or subsequent restoration:

- J-12 Center of Section Black Oak 30" N1° W Hickory 15" S15° E 3 Taken from County Su

J-13 South 1/4 Post Stone, County Road C 24" Oak W 130.7' 12" Oak NW 30.0'

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- J-12 Center of Section, S lines. Dug 4'x4'x2' original ground level
- J-13 South 1/4 post, Found stone with three raised to surface with

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- | | |
|--|--|
| #1 Set corner on line mid | #8 Set corner on line mid |
| J-12 #16 Nail & Cap in 18" #16 Nail & Cap in 18" #16 Nail & Cap in 14" Set 1/2"x24" Re-rod w Swan Road | J-13 #16 Nail & Cap in 24" #16 Nail & Cap in 24" #16 Nail & Cap in 24" #16 Nail & Cap in 10" Found stone 1.5' under raised with 1/2"x24" |

SIGNED BY George M. Young
 SURVEYOR'S MICHIGAN REGISTRATION NO. _____

SOURCE:

CORNER RECORDATION CERTIFICATE

TRANSCRIBED from ORIGINAL on file at REGISTER OF DEEDS
DUPLICATE

LAND CORNER RECORDATION CERTIFICATE
FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

FOR CORNERS OF:	LOCATED IN:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 3N S. R. 1E	A-4
2. PROPERTY CONTROLLING IN SECTION		
3. MISCELLANEOUS PROPERTY IN SECTION		
4. LOT NO.	RECORDED PLAT	
5. PRIVATE CLAIMS		

LIBER 48 202

FILED

MAY 17 1 56 PM '78

REGISTER OF DEEDS

Paul Johnson

INGHAM COUNTY, MICH.

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, George M. Young do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on June 7, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefor as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management of by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on June 7, 1977, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories used or subsequent restoration:

A-4 Original corner and accessories obliterated.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

A-4 Found 3/4" iron pipe under asphalt, 2' East of centerline of Meridian Road. Agrees with Ingham County Road Commission Information.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-4 Iron with cap
SE cor. house foundation - N 45° W 181.45'
Nail & Cap in 6" Cherry - N 45° E 49.08'
Nail & Cap in 6" Cherry - N 80° E 38.17'



SIGNED BY George M. Young DATE May 17, 1978

SURVEYOR'S MICHIGAN REGISTRATION NO. 17649 (SEAL)

FOR STATE AND UNITED STATES AGENCIES

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY _____ DATE _____ (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

1200

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 28, 1971
REVISED MAY 14, 1978

WHEATFIELD T. 3N, R. 1E A-4 0 p. 1 of 1
township corner code attachment no.

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

LIBER? 4 P 220

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 3 N. R. 1 E.	0-3
2. PROPERTY CONTROLLING IN SECTION	T. S. R. E.	
3. MISCELLANEOUS PROPERTY IN SECTION	T. S. R. E.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

FILED

JUN 30 1 19 PM '78

REGISTER OF DEEDS
Ruth Johnson
INGHAM COUNTY, MICH.

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Marvin F. Fouty, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 8-16, 1973, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

0-3 Original monument and accessories obliterated.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

0-3 Found 1/2" iron bar in monument box in Linn Road.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-3 NW corner Section 8, T3N, R1E, 1/2" bar in monument box. ✓
 Nail and Tag West side 3" Elm North 25.41' 60N1E
 Nail and Tag in Utility Pole ENE 86.09' → 11370
 Nail and Tag in 3" Elm ESE 55.55' 60N1E #

SIGNED BY Marvin Fouty DATE 6-26


SURVEYOR'S MICHIGAN REGISTRATION NO. 18989

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY _____ DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

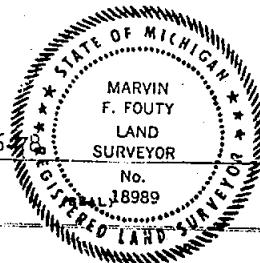

(SEAL)

1217

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 28, 1971
REVISED MAY 14, 1975

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET