

Williamston Twp.
Ingham Co.

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970
LIBER 3 PG 625

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY 31 Sec. T. 4 N. R. 1 E.	A-12, A-13	
2. PROPERTY CONTROLLING IN SECTION		
3. MISCELLANEOUS PROPERTY IN SECTION		
4. LOT NO. _____	RECORDED PLAT _____	
5. PRIVATE CLAIMS _____		

FILED

OCT 7 1 23 PM '76

REGISTER OF DEEDS

Emil M. Lewis
INGHAM COUNTY, MICH

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Maynard R. Dyer do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on July 15, 1976, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and or subsequent restoration:

A-12 Not set in original government survey, survey in S 1/2 of Section 31 and SW 1/4 Section 32 on June 13, 1894 by Wm H. Raynor, County Surveyor, dimensions shown are GLO.

A-13 Corner obliterated.

B. Description of corner evidence found and or method applied in restoring or re-establishing corner:

A-12 Set on meridian on fence line east, measurement south in close accord with GLO and County Surevyor mentioned above.

A-13 Set on meridian on fence line east, measurement north in close accord with GLO.
NOW GONE

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-12 W 1/4 Corner Section 31, T4N, R1E, set 1/2" bar and cap nail and tag in SE side 18" Ash, NE, 39.82' *GONE*
nail and tag in south side 15" ash, ENE, 30.73' *GONE*
nail and tag in U.P. SSW, 70.55' *(FD STEPHEN N&T)*

FD 1/2" SET W/SIDE 22 ASH

A-13 SW Corner Section 31, T4N, R1E, set 1/2" bar and cap nail and tag in east side U.P. NNW, 114.96'
1/2" bar at west edge of asphalt, west, 11.80'
1/2" bar at east edge of saphalt, east, 12.40'

SIGNED BY Maynard R. Dyer DATE 8-13-76


SURVEYOR'S MICHIGAN REGISTRATION NO. 21565

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

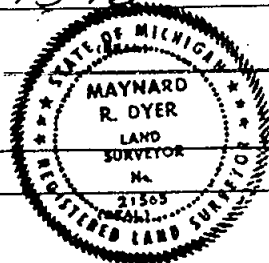

10-15-97

RHF

FD 1/2" BAR w/CAD 16053 & 28414

AZ 95° CONC. MON, ~~SWALLOW TAIL~~ SWALLOW TAIL
'34.32' LANE
BRANBANAKA

AZ 210, NET SE/SIDE POLE 70.52'
#16053

AZ 33° CONC MON 74.15'

AZ 20° NET C. BRN w/SIDE 22' ASD 115.16

AZ 352° NET " E/SIDE ♀ WOOD SPLIT RAIL POST
135.92'

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

LIBER 4 16 355

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY <u>X</u> T. <u>4</u> N. <u>X</u> R. <u>1</u> E. <u>X</u>		A-11
2. PROPERTY CONTROLLING IN SECTION _____ T. _____ N. _____ S. R. _____ E. _____ W. _____		
3. MISCELLANEOUS PROPERTY IN SECTION _____ T. _____ N. _____ S. R. _____ E. _____ W. _____		
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

FILED

SEP 19 9 01 AM '78

REGISTER OF DEEDS

R. Johnson

INGHAM COUNTY, MICH.

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Douglas W. Hooth, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on March 15th, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

1/2 inch Rod as described in 1941 Survey

NOTE:

THIS CERTIFICATE IS TO CORRECT THE ONE FILED IN LIBRE 4, PAGE 27 AS C-11. THE CORRECT DESIGNATION IS A-11 (SOUTH WEST OF SECTION 30)

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Found Rail Road spike at surface, dug down and found 1/2 inch rod as described and witnessed by H.R. Wilcox in 1941 Survey of Road Side Park.

Found Witnesses:


NW	60'	Fence Post
NE	73.2'	Wild Cherry

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

1/2 inch Pipe in Monument Box.

Witnesses:

N 75 E	73.20'	Nail and Tag in 20' Wild Cherry FOUNDED
N 22 W	59.93'	Nail and Tag in End Fence Post GONE
N 80 E	47.7'	North End of 12" Culvert
S 65 E	48.8'	South End of 12" Culvert
N 57 E	44.05'	Face of Street Sign Post
S 38 E	49.05'	Face of Bell Telephone Pedestal

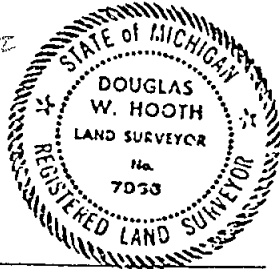

SIGNED BY _____ DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY Edwin L. Morse DATE 08-14-78

APPROVED AND SIGNED BY Douglas W. Hooth DATE 8/20/78

Mich. Dept. of State Hwys. & Trans. (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. 7966